




NB. To reset language to default (English) from home screen
press buttons in 4, 2, 1 order.



CAPTURE
Display

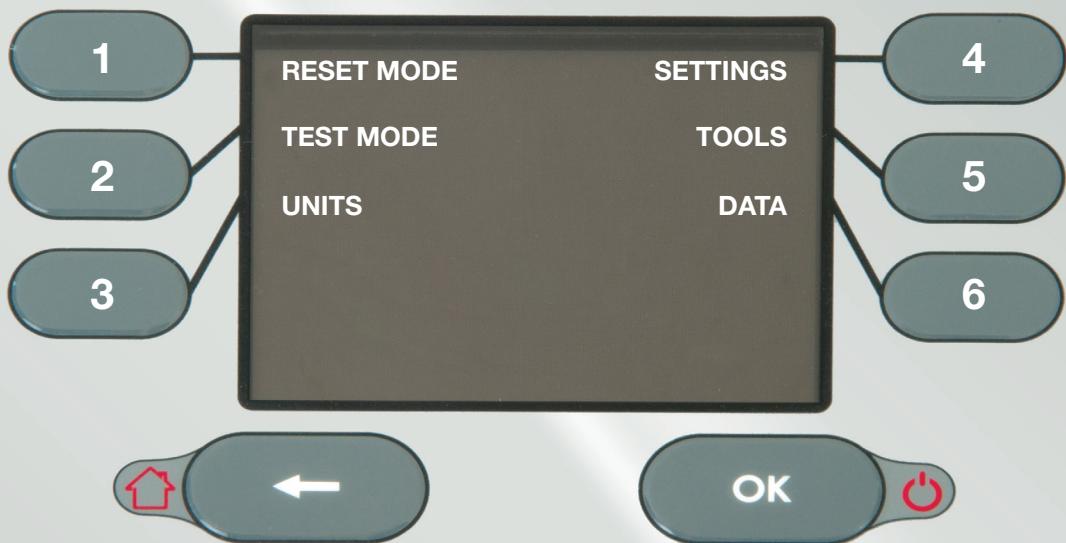

Start Up Guide

1 Reset Mode

Auto - Auto resets the reading once the selected time period has expired (1, 3 or 5 seconds).
Manual - Resets the reading only once the user has pressed the Back button.

2 Test Mode

Track - Progressively tracks the applied torque.
First Peak - Displays the First Peak torque value as well as the Peak torque value over the entire test period.
Peak - Displays the Peak torque value over the entire test period.

3 Units

Allows the user to choose from a range of Metric and Imperial torque units that suit the particular tool being analysed. Once the desired units have been selected they will be displayed on the home screen.

4 Settings

Allows the user to adjust the device language, time and date. Gives the user access to a helpline if assistance is needed with the device. Access to Start Up Guide.

5 Tools

Allows the user to add, edit and select tools for torque analysis. Tolerance limits for testing can also be specified. Storage for 500 tools.

6 Data

Stores the data of up to 2000 torque analysis results. The data stored includes the time and date, the transducer and tool used and the physical results of the analysis.

RESET (SINGLE PRESS) IN HOME SCREEN
BACK (SINGLE PRESS)
HOME (PRESS AND HOLD)

ENTER/ON (SINGLE PRESS)
OFF (PRESS AND HOLD)
TARE (SINGLE PRESS) IN HOME SCREEN



OK



TAKING THE RISK OUT OF TIGHTENING

CAPTURE System



Order Codes:

Order Code	Model
036700	Capture Display
036710	Capture Manager - PC Software
036805	CS 2 Capture Sensor
036810	CS 10 Capture Sensor
036820	CS 50 Capture Sensor
036830	CS 250 Capture Sensor
036845	CS 1500 Capture Sensor
036226	Capture Cable - Capture Display to Custom Sensor
036246	Capture Cable - Capture Display to Capture Sensor
036251	Capture Cable - Capture Display to SDX Screwdriver
036256	Capture Cable - Capture Display to ETX Wrench
036771	Capture Sensor ISO 1500/90° Adaptor
D18205	Capture Sensor ISO-A Mount
036772	Capture Sensor Quick Change Plate



Capture Display



CS 1500 Sensor

Torqueleader Sales Hotline **+44 (0) 1483 894 476**
or visit www.torqueleader.com